

# Part 573 Safety Recall Report

# 18V-362

**Manufacturer Name :** Starcraft RV**Submission Date :** JUN 01, 2018**NHTSA Recall No. :** 18V-362**Manufacturer Recall No. :** 9902385**Manufacturer Information :**

Manufacturer Name : Starcraft RV

Address : 903 South Main Street

P.O. Box 460 Middlebury IN 46540

Company phone : 800-945-4787

**Population :**

Number of potentially involved : 51

Estimated percentage with defect : 100 %

**Vehicle Information :**

Vehicle 1 : 2019-2019 Fifth Wheel Telluride

Vehicle Type : TRAILERS

Body Style :

Power Train : NR

Descriptive Information : Scope created from Supplier PO information noting delivery dates of defected straps (part # 0179191) - matched to Production records of units manufactured during same time frame.

K2FA5063-5084 K2FB5069-5092 K2FC5066-5073 K2FE5078-5083

Production Dates : APR 23, 2018 - MAY 22, 2018

VIN Range 1 : Begin :

NR

End : NR

 Not sequential**Description of Defect :**

Description of the Defect : The steel strap installed to secure the propane tank was improperly stamped (crimped) at the strap loop that secures the latch buckle to the strap. The strap may separate from the buckle and no longer secure the propane tank.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : A significant impact could place the unsecured propane tank at risk of damage and/or of coming out of its compartment, resulting in a fire/explosion causing person injury and/or property damage.

Description of the Cause : Incorrect die stamp used by Supplier

Identification of Any Warning that can Occur : NR

**Supplier Identification :****Component Manufacturer**

Name : Ventline/Dexter  
Address : 902 South Division Street  
Bristol INDIANA 46507  
Country : United States

**Chronology :**

5-17-18 during routine testing for production, discovered the strap installed to secure the propane tank could come apart at the latch/buckle leaving the tank unsecured. - Supplier contacted immediately 5-18-18 all stock of defective straps were removed and all units still on site had straps replaced with strap correctly stamped - Service Warehouse check for inventory of defective straps - none on hand - 5-24-18 Incident reported to Safety Steering Committee who voted that a safety Recall was required.

**Description of Remedy :**

Description of Remedy Program : Replace defective strap with new strap with correct crimping at latch of strap  
How Remedy Component Differs from Recalled Component : NR  
Identify How/When Recall Condition was Corrected in Production : NR

**Recall Schedule :**

Description of Recall Schedule : Starcraft Dealers will replace strap at no charge - release of recall will be determined by parts availability, release will not be longer than the 60 day time frame as required.  
Planned Dealer Notification Date : AUG 01, 2018 - AUG 01, 2018  
Planned Owner Notification Date : AUG 01, 2018 - AUG 01, 2018

\* NR - Not Reported