

Part 573 Safety Recall Report

18V-364

Manufacturer Name : Jayco, Inc.

Submission Date : JUN 06, 2018

NHTSA Recall No. : 18V-364

Manufacturer Recall No. : 9901385



Manufacturer Information :

Manufacturer Name : Jayco, Inc.

Address : 903 South Main Street

PO Box 460 Middlebury IN 46540

Company phone : 800-283-8267

Population :

Number of potentially involved : 612

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2018-2019 Fifth wheels Eagle, Eagle HT, NorthPointe,Pinnacle, Talon, Seismic

Vehicle Type : TRAILERS

Body Style :

Power Train : NR

Descriptive Information : Scope created from Supplier PO information noting delivery dates (4-17-18 - 5-17-18) of defected straps (part # 0281328) matched to production records of units manufactured in the same time frame defected straps were present.

Production Dates : APR 20, 2018 - MAY 23, 2018

VIN Range 1 : Begin :

NR

End : NR

Not sequential

Description of Defect :

Description of the Defect : The steel strap installed to secure the propane tank was improperly stamped (crimped) at the strap loop that secures the latch buckle to the strap. The strap may separate from the buckle and no longer secure the propane tank

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : A significant impact could place the unsecured propane tank at risk of damage and/or of coming out of its compartment resulting in a fire/ explosion causing personal injury and/or property damage.

Description of the Cause : Incorrect die stamp used by Supplier during manufacturing.

Identification of Any Warning NR
that can Occur :

Supplier Identification :

Component Manufacturer

Name : Ventline /Dexter
Address : 902 South Division St
Bristol INDIANA 46507
Country : United States

Chronology :

5-17-18 results from routine production testing, found strap installed to secure the propane tank could come apart at the latch / buckle leaving the tank unsecured - Supplier notified immediately 5-18-18 all stock of defective straps were removed and all units still on site had straps replaced with strap correctly crimped- Service WH was checked for defective straps - none in inventory - 5-24-18 Incident reported to Safety Steering Committee who voted that a safety recall was required

Description of Remedy :

Description of Remedy Program : Replace defective strap with strap with correct crimp at latch.
How Remedy Component Differs from Recalled Component : NR
Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : Jayco Dealer will replace strap at no charge - release of recall will be determined by parts availability, release will be prior to 60 day requirement of notice.
Planned Dealer Notification Date : AUG 01, 2018 - AUG 01, 2018
Planned Owner Notification Date : AUG 01, 2018 - AUG 01, 2018

* NR - Not Reported