

Part 573 Safety Recall Report

18V-686

Manufacturer Name : Jayco, Inc.**Submission Date :** OCT 02, 2018**NHTSA Recall No. :** 18V-686**Manufacturer Recall No. :** 9901408**Manufacturer Information :**

Manufacturer Name : Jayco, Inc.

Address : 903 South Main Street

PO Box 460 Middlebury IN 46540

Company phone : 800-283-8267

Population :

Number of potentially involved : 176

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2019-2019 Travel Trailer Jay Flight

Vehicle Type : TRAILERS

Body Style :

Power Train : NR

Descriptive Information : Production records noting when the new Smart Lights were first installed in travel trailers till correction was made.

2019 Jay Flight Travel Trailers

K1T20171-0212 K1T50081-0098 K1TV0147-0176 K1TB0231-0290 K1TE0050

K1T90231-0260 K1TN0129-0140 K1T60141-0164

Production Dates : AUG 01, 2018 - AUG 23, 2018

VIN Range 1 : Begin :

NR

End : NR

 Not sequential**Description of Defect :**

Description of the Defect : Failure to directly wire the rear stop/turn/brake lights to the 7 way trailer cord as specified caused the lights to come on then go off and remain off.

FMVSS 1 : 108 - Lamps, reflective devices, and assoc. Equipment

FMVSS 2 : NR

Description of the Safety Risk : Inoperable rear stop/turn/ brake lights could increase the risk of a crash with personal injury and /or property damage.

Description of the Cause : Failure to follow wiring print and improper testing of exterior lights during manufacturing

Identification of Any Warning that can Occur : NR

Supplier Identification :**Component Manufacturer**

Name : NR

Address : NR

NR

Country : NR

Chronology :

8-28-18 multiple Incident reports noted transportation company reporting issues with brake lights not working - Corp. Engineering/Production started investigation immediately into matter and upon inspection found units were wired incorrectly when a new component (Smart Control Module) was introduced to the Jay Flight production line - All Jay Flights on site and in transportation yard were placed on hold until corrected.
9-27-18 Safety Committee reviewed Incident and decided that a safety and non compliance recall was required.

Description of Remedy :

Description of Remedy Program : Correct wiring to match print 0.105.550 - wiring the exterior lights (rear stop/turn/brake) to the 7-way trailer cord instead of the Smart light circuit.

Plan for reimbursement is on file with NHTSA.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : 8-28-29 2018 -Production reviewed proper wiring for the exterior lights and the correct testing procedure - and all units on site were corrected

Recall Schedule :

Description of Recall Schedule : We are prepared to release recall upon receipt of assigned recall number and NHTSA approval - remedy at no charge to current owner

Planned Dealer Notification Date : OCT 30, 2018 - OCT 30, 2018

Planned Owner Notification Date : OCT 30, 2018 - OCT 30, 2018

* NR - Not Reported