

Part 573 Safety Recall Report

19V-042

Manufacturer Name : Winnebago Industries, Inc

Submission Date : JAN 17, 2019

NHTSA Recall No. : 19V-042

Manufacturer Recall No. : NR



Manufacturer Information :

Manufacturer Name : Winnebago Industries, Inc

Address : PO BOX 152
605 W. Crystal Lake Rd. Forest City IA
50436

Company phone : 1-641-585-3535

Population :

Number of potentially involved : 3,351

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2012-2018 Winnebago ERA

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : Cabinets shelves did not have the required number of fasteners to hold the shelf to the cabinet face. Affected the entire population up thru hold notice 876

Production Dates : NOV 11, 2010 - JAN 16, 2019

VIN Range 1 : Begin :

NR

End : NR

Not sequential

Description of Defect :

Description of the Defect : Overhead cabinet shelf may detach from the cabinet face and fall down in the cab area.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : If the shelf would fall while in transit the driver and passenger may be injured from the shelf and the contents of the cabinet falling them and/or could become a distraction to the driver, which could lead to a crash causing to death or injury

Description of the Cause : Cabinets shelves did not have the required number of fasteners to hold the shelf to the cabinet face

Identification of Any Warning that can Occur : One or more cabinet screws coming loose.

Supplier Identification :

Component Manufacturer

Name : NR
Address : NR
NR
Country : NR

Chronology :

1-3-19 S/N 15X14469 ORMU opened identifying OVHD shelf fell down on customer
1-4-19 Investigating found a Change Request opened June/July 2018 due to a shelf failure
1-7-19 Found ORMU on S/N 15W12962 was opened on 9-18-18 for shelf failure
1-7-19 Found S/N 15W12408 & 15W12615 on "Face Book" with a stated shelf failure
1-11-19 Safety Committee determined this issue is recallable
1-15-19 Submitted to NHTSA portal

Description of Remedy :

Description of Remedy Program : Adding two support brackets and 18 screws along with a Warning label with MAX capacity of this storage space.
How Remedy Component Differs from Recalled Component : The door opening will have a label installed stating the MAX capacity of the storage space.
Identify How/When Recall Condition was Corrected in Production : Adding two support brackets and 18 screws along with a label stating the MAX capacity of the storage space.

Recall Schedule :

Description of Recall Schedule : NR
Planned Dealer Notification Date : NR - NR
Planned Owner Notification Date : NR - NR

* NR - Not Reported