

# Part 573 Safety Recall Report

# 19V-058

**Manufacturer Name :** Keystone RV Company

**Submission Date :** JAN 28, 2019

**NHTSA Recall No. :** 19V-058

**Manufacturer Recall No. :** 19-341



## Manufacturer Information :

**Manufacturer Name :** Keystone RV Company

**Address :** PO Box 2000  
2642 Hackberry Drive Goshen IN  
46527

**Company phone :** 574-535-2100

## Population :

**Number of potentially involved :** 100

**Estimated percentage with defect :** 100 %

## Vehicle Information :

**Vehicle 1 :** 2019-2019 Keystone Montana 3855BR

**Vehicle Type :** TRAILERS

**Body Style :**

**Power Train :** NR

**Descriptive Information :** Model with kitchen slide out over tires.

**Production Dates :** JUN 05, 2018 - OCT 26, 2018

**VIN Range 1 : Begin :** 4YDF3852XK4700837 **End :** 4YDF38526K4702164  **Not sequential**

## Description of Defect :

**Description of the Defect :** It has been decided that the vehicles in this recall population may have an adjustment bolt for the kitchen slide that can come into contact with the tire.

**FMVSS 1 :** NR

**FMVSS 2 :** NR

**Description of the Safety Risk :** If the bolt comes into contact with the tire during travel, there is an increased risk of a tire blow out leading to the possibility of property damage and poor vehicle handling.

**Description of the Cause :** The 3855BR model was built with too long of an adjustment bolt that allows the bolt to come into contact with the tire.

**Identification of Any Warning that can Occur :** During pre-trip inspection there would be noticeable damage to the front tire under the kitchen slide.

## Supplier Identification :

**Component Manufacturer**

Name : NR  
Address : NR  
NR  
Country : NR

### Chronology :

November 6, 2018 – Production found that the adjustment bolt was in close proximity of the tire when the slide room was closed.  
January 21, 2019 – Investigation concluded and determined that the bolt was too long and that an inspection of all 3855BR models are needed to determine if repairs are needed.

### Description of Remedy :

Description of Remedy Program : The remedy is to replace the incorrect length of adjustment bolt with a 2” bolt.  
How Remedy Component Differs from Recalled Component : The shorter 2” bolt will allow proper clearance for the tire during travel.  
Identify How/When Recall Condition was Corrected in Production : Units were quarantined, inspected then repaired as indicated by inspection.

### Recall Schedule :

Description of Recall Schedule : Keystone will notify the dealers and owners of the recreational vehicles by letter. A final copy of the owner letter will be provided to NHTSA, along with the dealer repair procedures.  
Planned Dealer Notification Date : MAR 15, 2019 - MAR 15, 2019  
Planned Owner Notification Date : MAR 15, 2019 - MAR 15, 2019

\* NR - Not Reported